



中部驱动3槽型材(带轮直径50mm)

马达规格: 25W

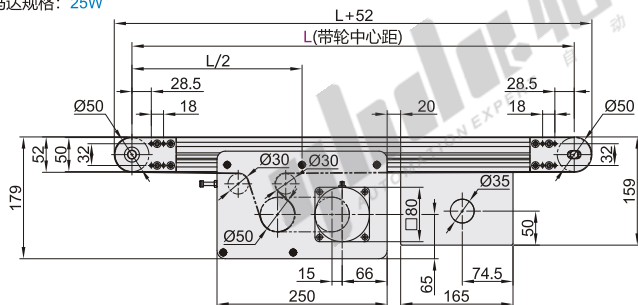

❗ 图中的尺寸为皮带规格K(厚1mm)的尺寸, 请注意皮带厚度因皮带规格而异

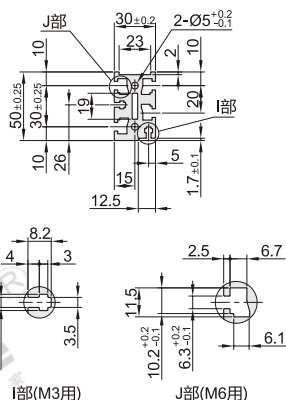

❗ 可使用GB/T 6170规格的六角螺母。

Technical drawing of a mechanical part, showing front and side views with dimensions.

Front View Dimensions:

- Overall width: 250
- Overall height: 179
- Top flange thickness: 18
- Bottom flange thickness: 63
- Distance from left edge to center of first hole: 65
- Distance between centers of two holes: 18
- Distance from right edge to center of second hole: 63
- Overall depth: 90
- Hole diameters: $\varnothing 30$ (smaller holes), $\varnothing 50$ (larger hole)
- Feature A: A dashed line indicates a feature labeled 'A' on the top surface.

Side View Dimensions:

- Overall height: 30
- Feature A: A dashed line indicates a feature labeled 'A' on the side surface.

Technical drawing of the 1000mAh 3.7V Li-ion battery showing front, side, and top views with dimensions:

- Front View (Top):** Shows a width of 160mm and a height of 86mm. The left side features a USB-A port and a micro-USB port.
- Side View (Top):** Shows a thickness of 2mm.
- Front View (Bottom):** Shows a width of 136mm and a height of 76mm. The left side features a USB-A port and a micro-USB port.
- Side View (Bottom):** Shows a thickness of 51mm.
- Top View (Bottom):** Shows a width of 136mm and a height of 76mm. The right side features four mounting holes labeled "4-M3" and "固定用螺丝孔" (Fixed mounting screw hole).

输出功率 (W)	马 达		减速比	A
	规格	制造商		
25W	三相马达	国产	7.5~18	131
			25~180	
	速度控制马达		7.5~18	141
			25~180	
	三相马达	松下	7.5~180	115
	速度控制马达			
40W		国产	7.5~18	168
	三相马达			
	速度控制马达		7.5~18	178
			25~180	
	三相马达	松下	7.5~180	142
	速度控制马达			

❗ 长时间使用调节刻度不可低于60, 调节刻度过低, 马达扭矩减小, 马达容易过载, 同时调低马达速度, 马达的动能会转化为热能, 会导致马达过热。(输送能力对照表是指刻度在100的输送能力)。

背光型 ▶ 平皮带输送机

中部驱动3槽型材(带轮直径50mm)

型号		L	E	F	马达选择					马达品牌	光源颜色
代码	B	最小单位5	光源位置	光源长度	输出功率(W)	电压(V)	规格	齿轮头减速比	皮带规格	选择	
KPJ01	200	700~3000	105~2290	500	25	TA220(单相)	SCM	7.5 9 12.5 15	K(普通皮带)	T(国产品牌)	A(白色)
	速度控制马达					18 25 30 36 50	S(松下马达)	B(红色)			
						60 75 90 100	L(进口皮带)			C(蓝色)	
						120 150 180	J(无皮带)				
					40	SA200(三相)	INV 变频器				
	350					NV(无马达)	NM(无马达)	NH(无齿轮头)		W(无马达)	

请按图示订货

型号		L	E	F	马达选择					马达品牌	光源颜色
代码	B	最小单位5	光源位置	光源长度	输出功率(W)	电压(V)	规格	齿轮头减速比	皮带规格	马达选择	
KPJ01	200	700-3000	105-2290	500	25	TA220(单相)	SCM 速度控制马达	7.5 9 12.5 15 18 25 30 36 50 60 75 90 100	K(普通皮带) L(进口皮带) J(无皮带)	T(国产马达) S(松下马达)	A(白色) B(红色) C(蓝色) D(绿色)
	250										
	300										
	350										
				800	40	SA200(三相)	INV(变频器)	120 150 180			
						NV(无马达)	NM(无马达)	NH(无齿轮头)		W(无马达)	

KPJ01—B200—L2000—E300—F500—25—TA220—SCM—15—K—T—A

可选加工

型号		L	E	F	马达选择				马达品牌	光源颜色	可选加工代码
代码	B	最小单位5	光源位置	光源长度	输出功率(W)	电压(V)	规格	齿轮头减速比	皮带规格		
KPJ01	200	700~3000	105~2290	500	25	TA220(单相)	SCM 速度控制马达	7.5 9 12.5 15 18 25 30 36 50 60 75 90 100	K(普通皮带) L(进口皮带) J(无皮带)	T(国产品牌) S(松下马达)	A(白色) B(红色) C(蓝色) D(绿色)
	250										
	300										
	350										
					40	SA200(三相)	INV 变频器	120 150 180			
						NV(无马达)	NM(无马达)	NH(无齿轮头)		W(无马达)	


KPJ01—B200—L2000—E300—F500—25—TA220—SCM—15—K—T—A—MC300

可选加工

代码	MC()
技术说明	驱动部位置指定 选型方法 MC500

代码	MB()
技术说明	附带后装螺帽 选型方法 MB3 ① 请指定附带后装螺帽数量。 如：MB3表示每条槽3个螺母

EX
Example
使用示例

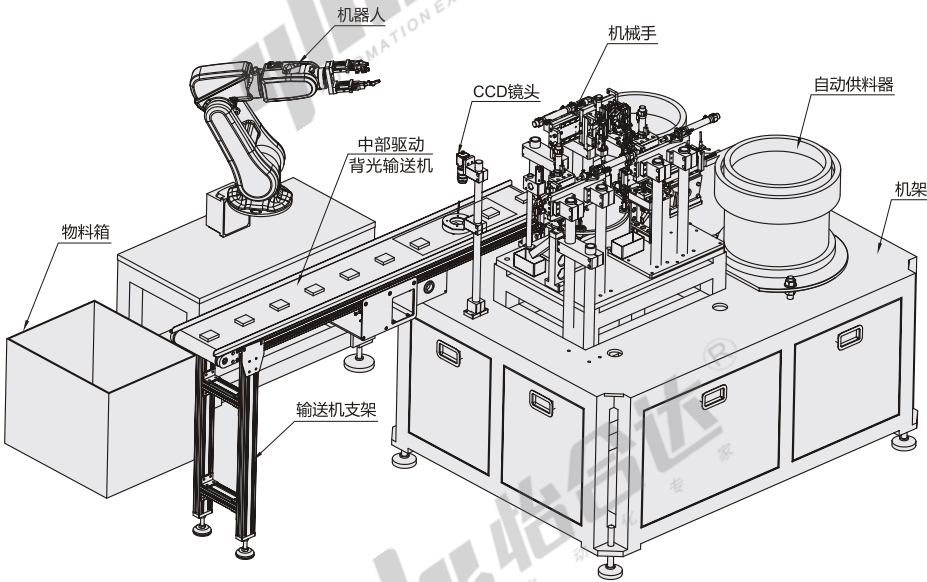

① KPJ系列用于精密零配件的异物检查、搭载CCD实现自动上下料的理想背光型输送机